	UNCLASSIFIED SECURITY CLASSIFICATION OF THIS PAGE (When Date Entered)	X/ LCVC
*3	REPORT DOCUMENTATION PAGE	BEFORE COMPLETING POARS
多一	TOP-3-2-816	NO. 3. RECIPIENT'S CATALOG HUMBER
	4-77TLE (MIC Oubtitle)	5. TYPE OF REPORT & PERIOD COVERE
001	U. S. ARMY TEST AND EVALUATION COMMAND TEST OPERATIONS PROCEDURE	Final TO ARE REPORT NUMBER
	HOP FIRING,	
<b></b>	3 AGTHOR(s)	8. CONTRACTION GRANT NUMBER(*)
9	9. PERFORMING ORGANIZATION NAME AND ADDRESS	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
<b>辺</b>	U. S. ARMY ABERDEEN PROVING GROUND (STEAP-MT-M) ABERDEEN PROVING GROUND, MARYLAND 21005	DARCOM-A 310-6
	11. CONTROLLING OFFICE NAME AND ADDRESS	A REPORT DATE
W (	U. S. ARMY TEST AND EVALUATION COMMAND (DRSTE-AD)ABERDEEN PROVING GROUND, MARYLAND 21005	10
AD	14. MONITORING AGENCY NAME & ADDRESS(If different from Controlling Office	15. SECURITY CLASS. (of this
_		Unclassified 15. DECLASSIFICATION/DOWNGRADING
ļ	16. DISTRIBUTION STATEMENT (of this Report)	SCHEDULE
	Approved for public release; distribution unlimite	
		JUL 12 1978
	17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different	from Report)
<b>y</b> d(		g B
$\mathcal{S}$	18. SUPPLEMENTARY NOTES	
1.1		
LI.	19. KEY WORDS (Continue on reverse side if necessary and identify by block numb	er)
دے	Artillery, Self-propelled Artillery, Towed	
	Hop Firing	
	*Carriage Displacement	
\	*New 20. ABSTRACT (Continue on reverse side if necessary and identity by block number	7)
Ÿ	Describes procedures for measuring the carriage measuring the carria	otion of towed and
	self-propelled weapons during firing and the final after firing. Applies to towed and self-propelled	carriage displacement artillery.
	Q.4	I 75Z
•	DD FORM 1473 EDITION OF 1 NOV 65 IS OBSOLETE	UNCLASSIFIED
	SECURITY CL	ASSIFICATION OF THIS PAGE (When Date Enter

8 6 22 05

### US ARMY TEST AND EVALUATION COMMAND TEST OPERATIONS PROCEDURE

DRSTE-RP 702-102
\*Test Operations Procedure 3-2-816
AD No.

18 May 1978

#### HOP FIRING

			Page
Paragraph	1.	SCOPE	1
υ.	2.	FACILITIES AND INSTRUMENTATION	
	3.	PREPARATION FOR MEASUREMENT	2
	4.	MEASUREMENT CONTROLS	2
	5.	MEASUREMENT	3
	5.1	Carriage Hop	3
	5.2	Carriage Displacement	6
	6.	DATA REDUCTION AND PRESENTATION	6
APPENDIX		CHECKLIST GUIDE FOR HOP FIRING	9

1. SCOPE. This TOP describes procedures for measuring the carriage motion of towed and self-propelled weapons during firing (commonly referred to as "hop") and the final carriage displacement after firing.

#### 2. FACILITIES AND INSTRUMENTATION.

ITEM

# Record cards White cardboard, sized to contain the expected hop pattern or motion between parts of an assembly Card supports Fixtures to firmly support hop cards Pencil holder Similar to figure 1


REQUIREMENTS

Pencil-holder brackets To firmly secure pencil holder to test item (para 5.1.1.1a)

High-speed framing camera 100 frames per second or more depending on the expected speed of the motion.

\*This TOP supersedes MTP 3-2-816, 15 June 1966.

Approved for public release; distribution unlimited.

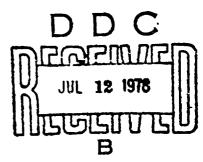

18 May 1978

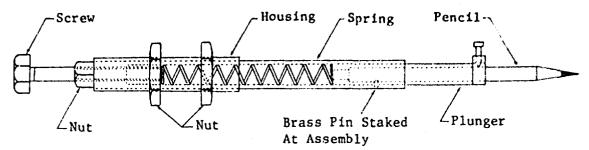


Figure 1. Pencil holder for hop records.

#### 3. PREPARATION FOR MEASUREMENT.

#### 3.1 Planning.

TOP 3-2-816

- a. From the planned tests of the weapon select a firing subtest suitable for measuring hop concurrently with other test data. The subtest selected should include:
  - (1) Various firing elevations and directions of fire.
- (2) The firing of each type of round or propelling charge used by the weapon.
- b. Design a data-collection sheet for recording round-by-round data as required by the particular measurement technique.
- c. Prepare a test operations checklist using the appendix as a guide and adding specifics for the test item and situation.

#### 3.2 Weapon and Facilities.

- a. Emplace the weapon with the carriage on the ground unless otherwise specified. Be sure that the ground is solid enough for the spade to be effective.
  - b. Fire at least one round to seat the weapon.

#### 4. MEASUREMENT CONTROLS.

- a. Be sure that pencil-holding brackets are rigidly secured and that the pencils are firmly held.
- b. When the pencil is mounted on a wheel hub, lock the brakes so that the wheel cannot rotate. (Rotation of the wheel can produce an erroneous record if the pencil is not perfectly centered.)
- c. Firmly seat the record-card supports to prevent wobbling and to withstand backblast.

18 May 1978 TOP 3-2-816

- 5. MEASUREMENTS.
- 5.1 Carriage Hop.
- 5.1.1 Hop-Card Records.

#### 5.1.1.1 Method.

- a. Attach pencil holders to the test item so that the pencil will be perpendicular to the expected direction of motion. For self-propelled weapons, typical attachment points are the drive sprocket (fig 2) or roadwheel hubs or corner points of the carriage. For towed weapons, typical attachment points are wheel hubs (fig 3) when the axle is not pivoted to the bottom carriage, trail ends, or bottom carriage.
- b. Position the card supports parallel to the expected direction of motion with the record card in contact with the pencil.
- c. If the relative motion between two parts of an assembly as a result of firing is to be measured, mount a record card on one part and a pencil-holding bracket on the other. A linear variable displacement transformer may be used for this measurement when displacement versus time is of interest.
- d. Label the point at which the pencil makes contact with the record card before firing as "1" or "start."
- e. Fire the weapon and record carraige movement through one complete recoil and counterrecoil cycle.
- f. After firing, label the point at which the pencil comes to rest as "2" or "stop."
- g. Repeat the above measurement procedure as necessary to obtain reocrds for each firing condition of interest.
- 5.1.1.2 <u>Data Required</u>. Record the following data for each hop record as applicable:
  - a. Test-item nomenclature.
  - b. Pencil attachment points.
  - c. Date of firing.
  - d. Round number.
  - e. Gun elevation and azimuth.
  - f. Propelling charge.

TOP 3-2-816 18 May 1978

- g. Soil condition (hard, soft, sandy, etc.).
- h. Tire air pressures if the weapon is fired with tires in contact with the ground.
  - i. Manner in which the weapon is emplaced.
- j. If the hydraulic lockout system (provided on some weapons to afford a rigid firing base) was used.

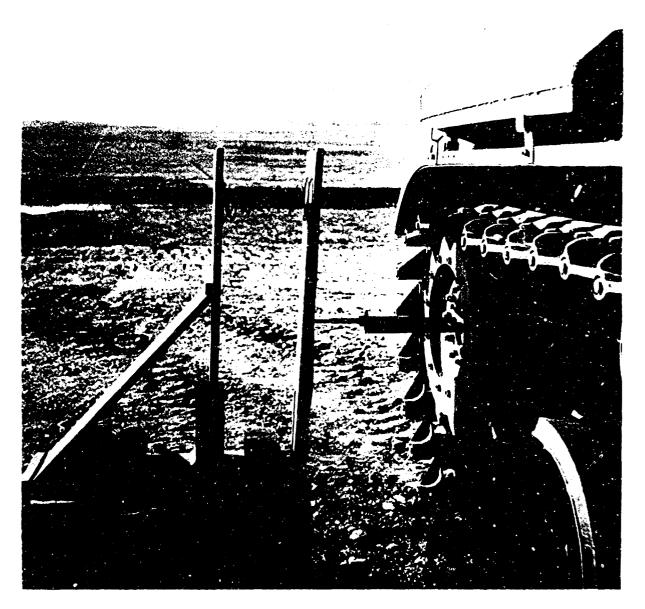


Figure 2. Position of hop-recording equipment on drive sprocket of self-propelled vehicle.

18 May 1978 TOP 3-2-816

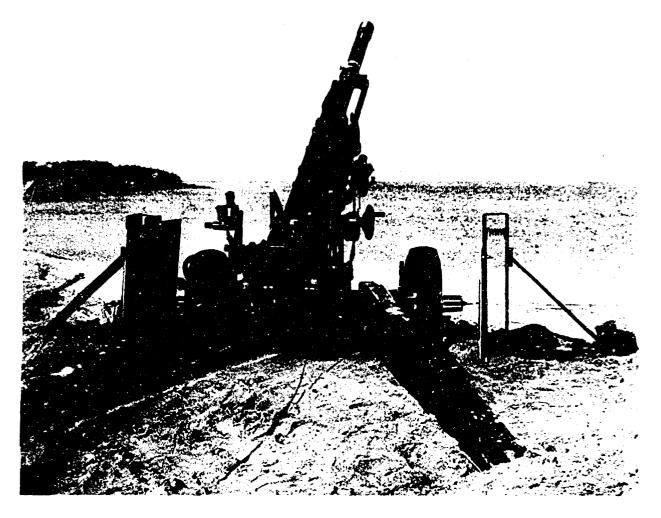


Figure 3. Position of hop-recording equipment on wheel hubs of towed weapon.

5.1.2 Photographic Records. Cameras can be used in conjunction with accurately placed reference marks to record time verses distance of movement. Timing marks on the film are used to establish the timetravel relationship.

#### 5.1.2.1 Method.

- a. Paint or tape crossmarks on the test item at selected points in the vertical plane of interest (bottom carriage, trails or spades, cradle or tube, etc.).
- b. Position the camera(s) to photograph carriage movement following the guidance of TOP/MTP 4-2-816.
- c. Mount a fixed reference crossmark in the camera field of view to aid in measuring displacement.

TOP 3-2-816 18 May 1978

d. Measure and record distances between camera, crossmarks, and fixed reference.

- e. Fire the weapon and record carriage movement through one complete recoil and counterrecoil cycle.
- f. Repeat the above procedure as necessary to obtain records for each firing condition of interest.

#### 5.1.2.2 Data Required.

- a. Distances between camera, crossmarks, and fixed reference.
- b. Camera focal length, framing speed, and timing-mark rate.
- c. Data as required for hop records in paragraph 5.1.1.2.

#### 5.2 Carriage Displacement.

#### 5.2.1 Method.

- a. For rearward displacement, firmly position a stake in the ground in front of the weapon carriage, offset from the line of fire and 30 to 60 centimeters behind the maximum rearward position of the muzzle to preclude movement as a result of muzzle blast.
- b. For sideward displacement, firmly position two or more stakes in the ground to the side of the weapon and parallel to the longitudinal axis of the carriage.
- c. Record the distance from each stake to fixed points on the carraige.
  - d. Fire the weapon and again measure distances as in c above.
- e. Record carriage displacement as the difference between the measurements obtained in steps c and d above.
- f. Repeat the above procedure as necessary to obtain measurements for each firing condition of interest.


#### 5.2.2 Data Required.

- a. Carriage displacement and direction of movement.
- b. Data as required for hop records in paragraph 5.1.1.2.

#### 6. DATA REDUCTION AND PRESENTATION.

- a. Tabulate all data.
- b. Present hop-record data as shown in figure 4. Group the records by round number, firing elevation, and carriage position. When records are reproduced in other than full size, include a scale on the reproduction.

TOP

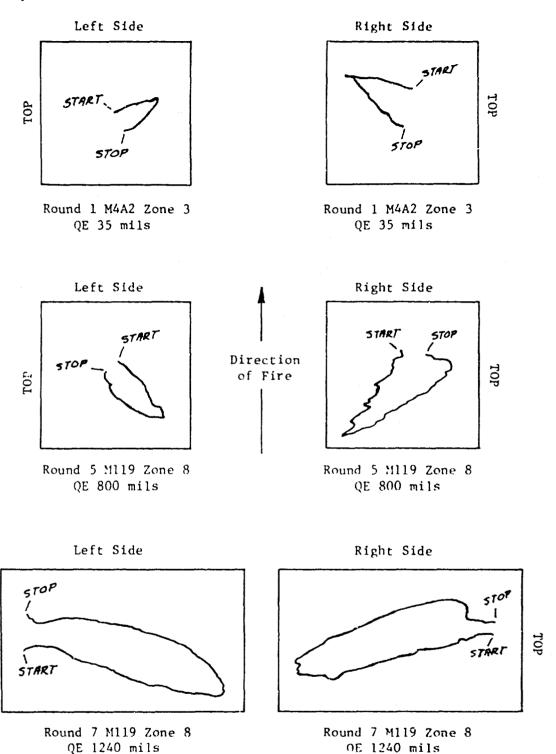

Full Scale

NOTE: View this page with card properly oriented for correct perspective.

Figure 4. Typical hop-record data.

TOP 3-2-816 18 May 1978

c. When appropriate, show a diagram of the carriage, indicating the point of attachment for the pencil brackets. This is particularly important for self-propelled weapons for which hop records are made for various directions of fire.

d. Analyze the photographic records to determine displacement distances versus time, using film-reader equipment.

Recommended changes to this publication should be forwarded to Commander, U. S. Army Test and Evaluation Command, ATTN:
DRSTE-AD-M, Aberdeen Proving Ground, MD 21005. Technical information may be obtained from the preparing activity: Commander, U. S. Army Aberdeen Proving Ground, ATTN: STEAP-MT-M, Aberdeen Proving Ground, MD 21005. Additional copies are available from the Defense Documentation Center, Cameron Station, Alexandria, VA 22314. This document is identified by the accession number (AD No.) printed on the first page.

## APPENDIX CHECKLIST GUIDE FOR HOP FIRING

	ITEM	YES	NO	NA
1.	All operating personnel briefed on test requirements, special procedures, hazards, and any unusual aspects of test.			
2.	Ammunition components inspected, assembled, available, and identified.			
3.	Weapon properly emplaced (lay established, spades dug in, seating round fired, etc.).			
4.	Pencil-holder brackets rigidly secured.			
5.	Record cards firmly supported.			
6.	Camera(s) positioned properly (field of view checked).			
7.	Camera loaded and checked for operation (proper lens, framing rate, IRIG timing, etc.).			
8.	Safety requirements accomplished (SOP checklist completed and SOP posted*).		-	
9.	Required data recorded.			

<sup>\*</sup>SOP 385-67 at APG.